


ICOM 756 Pro II and Pro III Output Power Adjustment

If your Icom 756 P2 or P3 is putting out less than the 105 watts specification on HF on cw, you can increase the power level by turning potentiometer R507 shown in the diagram below slightly clockwise. This adjustment only applies if you have the same low output on all the HF bands. Recently some new IC 756 P3's have had low output on one or more bands while the other bands are fine. This adjustment does not apply for those rigs with that problem. You need a good wattmeter to know what your output power actually is. Don't mess with this adjustment if you don't have a good wattmeter.

• MAIN-A unit

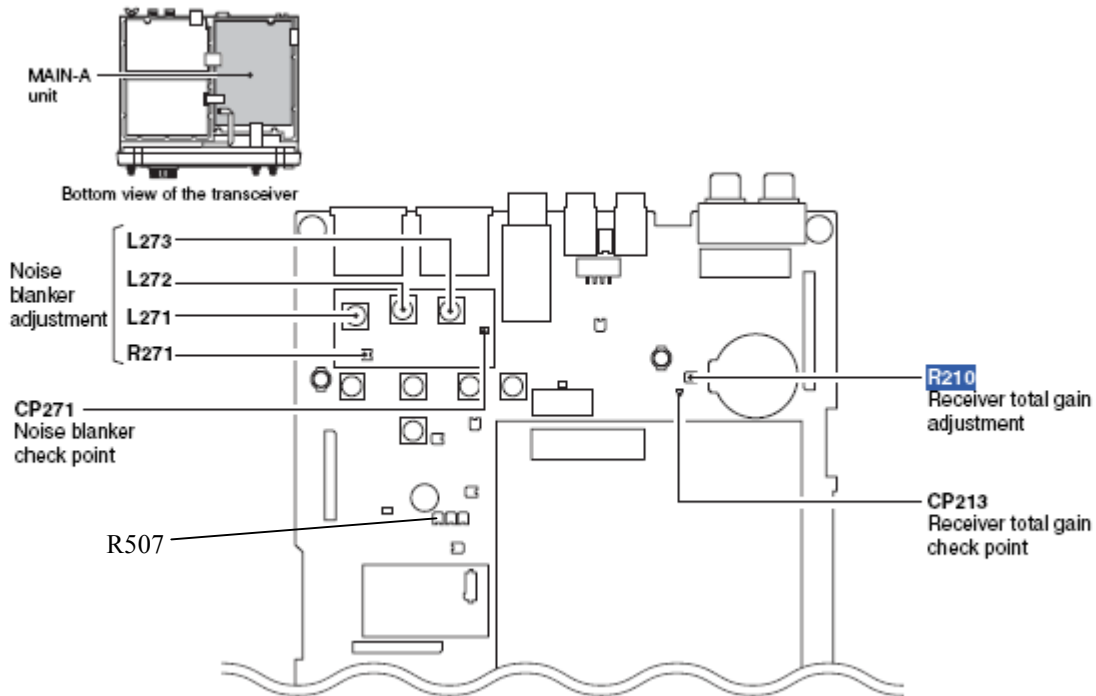

Note, K5GP is not responsible if you break your radio making this adjustment. If you do not agree with this, please do attempt the adjustment.

73 de k5gp, Gene

<http://egpreston.com>